

31

Date: Tuesday, 7/1/2008 10:49:26 AM  
 User: Kim Johnston

## Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : 212/205 HIGH FED X-TUBE ASSEMBLY
Job Number : 40176	
Estimate Number : 10254	
P.O. Number :	Part Number : D212664101
This Issue : 7/1/2008 S.O. No. :	Drawing Number : D212-664-141 REV C
Prsht Rev. : NC	Project Number : N/A
First Issue : / / Type : CROSSTUBES	Drawing Revision : C
Previous Run : 40175	Material :
Written By :	Due Date : 7/30/2008 Qty: 1 Um: Each
Checked & Approved By : <u>08.07.01</u>	
Comment : Est Rev:E 04.02.16 Reformat KJ/DS	
Est Rev:F 06-03-29 Remove Coments on Pick List JLM	
Est Rev:G 07-04-30 As per Rev C JLM	

## Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D212-664-101 CHG003

JLD 08.7.08

508/07/17

2.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

3.0	D212664101TRN	Crosstube Turning Detail
-----	---------------	--------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

CROSSTUBE TURNING DETAIL

batch 840172

EZ 8-7-7

4.0	BENDING	BENDING MACHINE - SKIDTUBES
-----	---------	-----------------------------



Comment: BENDING MACHINE

Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio FT015

DP 8-7-8

5.0	QC15	DIMENSIONAL CHECK OF X-TUBES
-----	------	------------------------------



Comment: DIMENSIONAL CHECK OF X-TUBES

0807-08 C

6.0	CROSSTUBES	CROSSTUBES RESOURCE 1
-----	------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

~~84 Scribe P/N: B# on the inside of the cuff~~  
 1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549

25 08-07-06

W/O: <del>40176</del> <del>EST # 10254</del>		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng/ Prod Mgr	Approval QC Inspector
<del>08-07-08</del>	<del>6.0</del>	<del>Please Add a detail to scribe the inside of the cuff with the P/W: B# for identification.</del> <del>perm. change</del>	<del></del>	<del>08-07-08</del>	<del></del>	<del></del>	<del></del>

*08-07-08 cancelled already done.*

Part No: D212-664-101 PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 7/1/2008 10:49:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH FED X-TUBE ASSEMBLY

Job Number: 40176

Part Number: D212664101

Job Number:



Seq. #:

Machine Or Operation:

Description :

2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

RT 06-07-08

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141

EL 8-7-8

4-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141

RT 06-07-08

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1 within 24 hours of bending and drilling

RT 06-07-08

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Sos 6/2/08 (1)

9.0

OUTSIDE SERV.10

OUTSIDE SERVICES -skids



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 038

Issue P/O: 6753

LPI as per ASTM 1417 Level 2

Attach copy of NDT results to work order

CD 8/07/11 (1)

10.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Inspect for transit damage Ensure copy of NDT results attached to work order.

PO 8/1/11 (1)

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: Inspect for damage & ensure results are as per Dwg D212-664-141

ml 08 07 14

(1)

12.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2

> ml 08 07 14 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 7/1/2008 10:49:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH FED X-TUBE ASSEMBLY

Job Number: 40176

Part Number: D212664101

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC14

INSPECT SPRAY PAINT



08-07-15 (1)

Comment: Inspect Spray Paint

Then, Wrap in plastic bag to protect from scratches

14.0

D28931

2.75 Support



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2893-1

Support

38614

ml 08 07 15

15.0

D3595063450

RUBBER CUSHION



Comment: Qty.: 4.2000 Each(s)/Unit Total : 4.2000 Each(s)

Rubber Cushion (per sq ft)

.630" X 4.5" 4PCS

Batch:

38959

ml 08 07 15

16.0

MS2192025

Clamp(per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch

4 MS21920-25

Clamp

108224

ml 08 07 15

17.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

2-Install supports with magnobond as per QSI 015 Adhere for for 12 Hrs

A/R 6398 Magnobond

Batch: 107621

Expiry Date: 08/2009

Time: 9:00am

3-Install clamps as per Dwg D212-664-141. Torque clamps to 80-100 in lb.

ml 08 07 16

(1)

08 07 15 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 7/1/2008 10:49:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH FED X-TUBE ASSEMBLY

Job Number: 40176

Part Number: D212664101

Job Number:



Seq. #:

Machine Or Operation:

Description:

18.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*08-07-16 (V)*

19.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

*Computers were down*

20.0

D34281

Placard



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

PLACARD

Batch: 39322

*please take out of comp*

*JS 08/07/17 (X)*

21.0

AN635A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Bolt

Batch: M107178

*JS 08/07/17 (X)*

22.0

AN636A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Bolt

Batch: M107534

*JS 08/07/17 (X)*

23.0

AN960JD616

Washer



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Washer

Batch: M107959

*JS 08/07/17 (X)*

24.0

MS21042L6

Nut



Comment: Qty.: 6.0000 Each(s)/Unit Total: 6.0000 Each(s)

Nut

Batch: M105077

*JS 08/07/17 (X)*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Tuesday, 7/1/2008 10:49:26 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH FED X-TUBE ASSEMBLY

Job Number: 40176

Part Number: D212664101

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

508/07/17 @

26.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Identify and pack for shipping as per PPP D212-664-101

Rev D

8/7/17

K1

SP

27.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/07/18

Job Completion



W 08/07/17

B40176 D 212-664-101

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

D'ART AEROSPACE LTD	Work Order:	40176
Description: Crosstube High Fwd (205/212/412)	Part Number:	D212-664-101
Inspection Dwg: D212-664-141 Rev: C		Page 1 of 1

Required Dimension	Min	Max
Height	26.79	27.05
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7

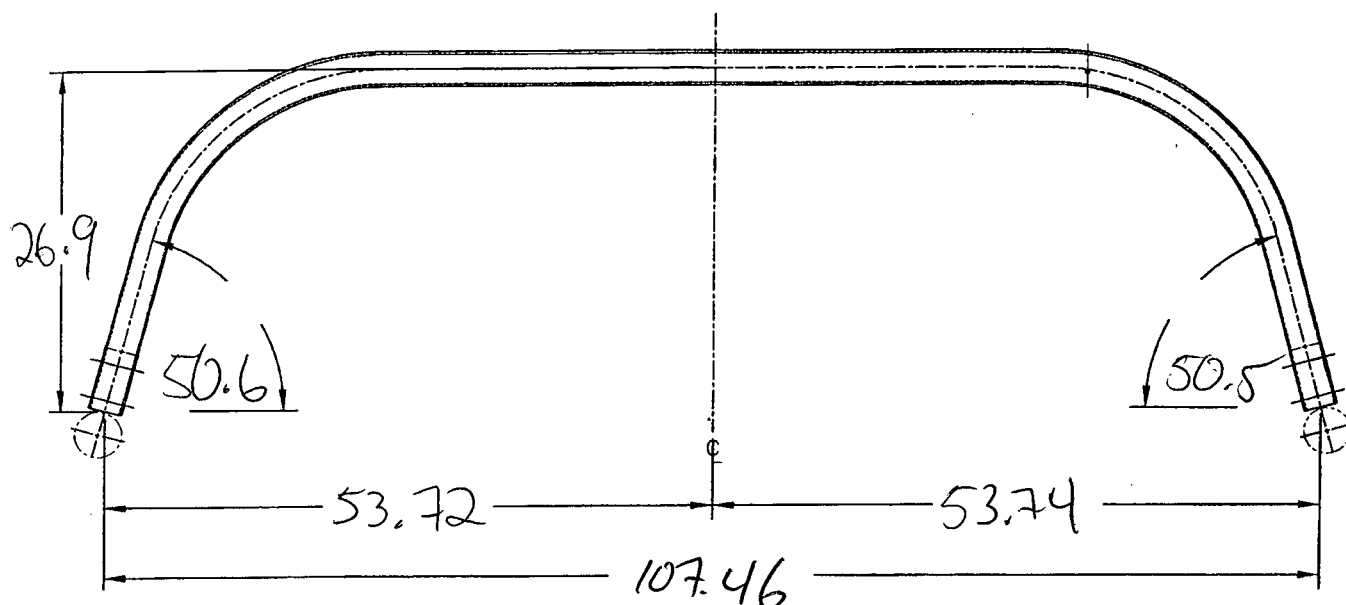

Comments

QC15 Inspection	
Date	04-07-08

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.31	Dimensions updated per Dwg Rev C	KJ/JM	



DESIGN <b>PH</b>	DRAWN BY <b>PH</b>	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED <b>GP</b>	APPROVED <b>[Signature]</b>	DRAWING NO. D212-664-141	REV. C SHEET 1 OF 3
DATE 07.03.08		TITLE XTUBE ASS'Y (205/212/412 HI FWD) NTS	
A	00.12.12	NEW ISSUE	
B	05.02.04	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	
C	07.03.08	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	

RELEASED

07.04.24 **[Signature]**

Qty	Part Number	Description
X	D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
1	D6005-128	CROSSTUBE
2	D2893-1	SUPPORT
4	D3595-063-450	RUBBER CUSHION
4	MS21920-25	CLAMP (OR MS21920-26)
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)



#### GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6005-128  
FINISHED LENGTH =  $126.51 \pm 0.020$
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 10) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT
- 11) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. **40176**

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

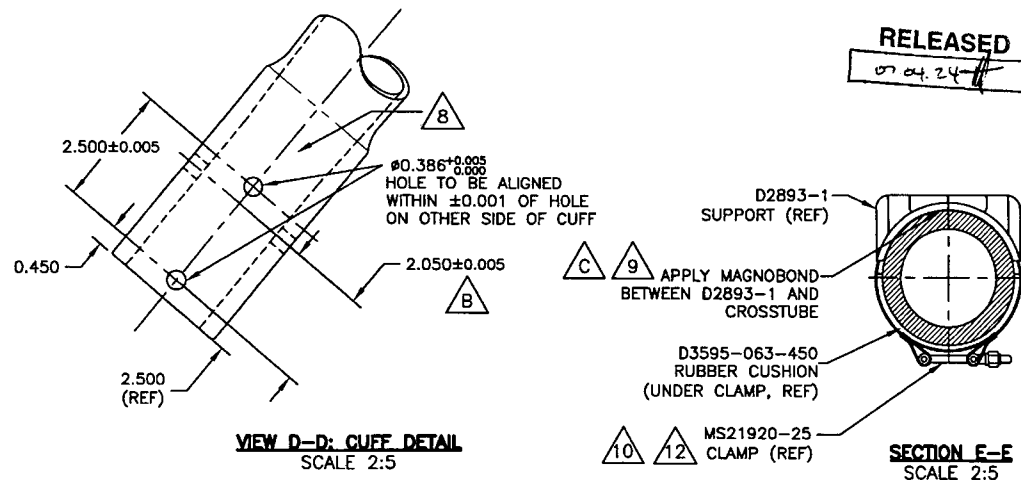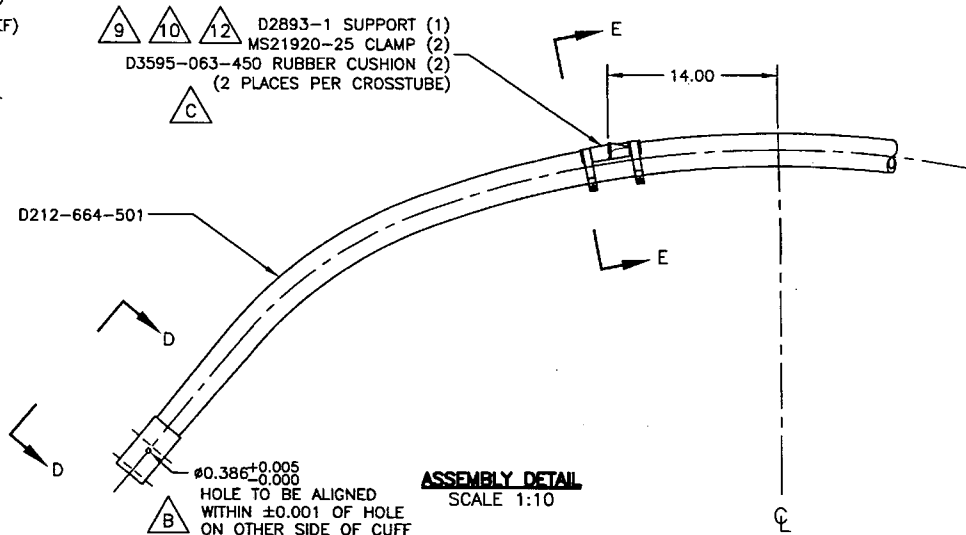


**RELEASED**



07.04.24

**COPYRIGHT © 2000 BY DART AEROSPACE LTD**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE LTD.


DESIGN	DRAWN BY	 <b>DART AEROSPACE LTD.</b> MISSISSAUGA, ONTARIO, CANADA
PH	PH	
CHECKED	APPROVED	DRAWING NO. D212-664-141
GP	JH	REV. C SHEET 2 OF 3
DATE	TITLE	
07.03.08	XTUBE ASS'Y (205/212/412 HI SCALE) 1:10	

**RELEASED**  
67.04.24 (P)  
PER ELN 887

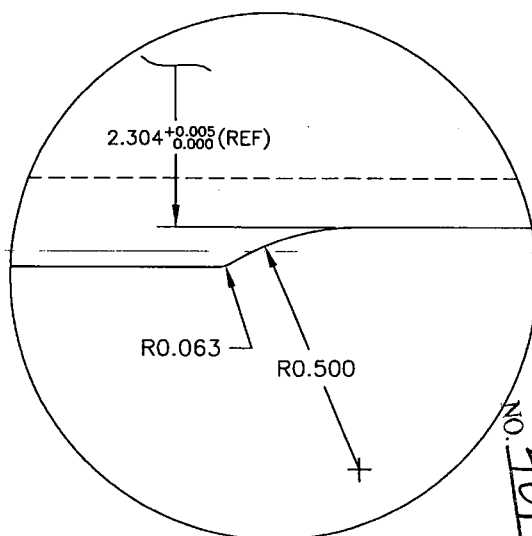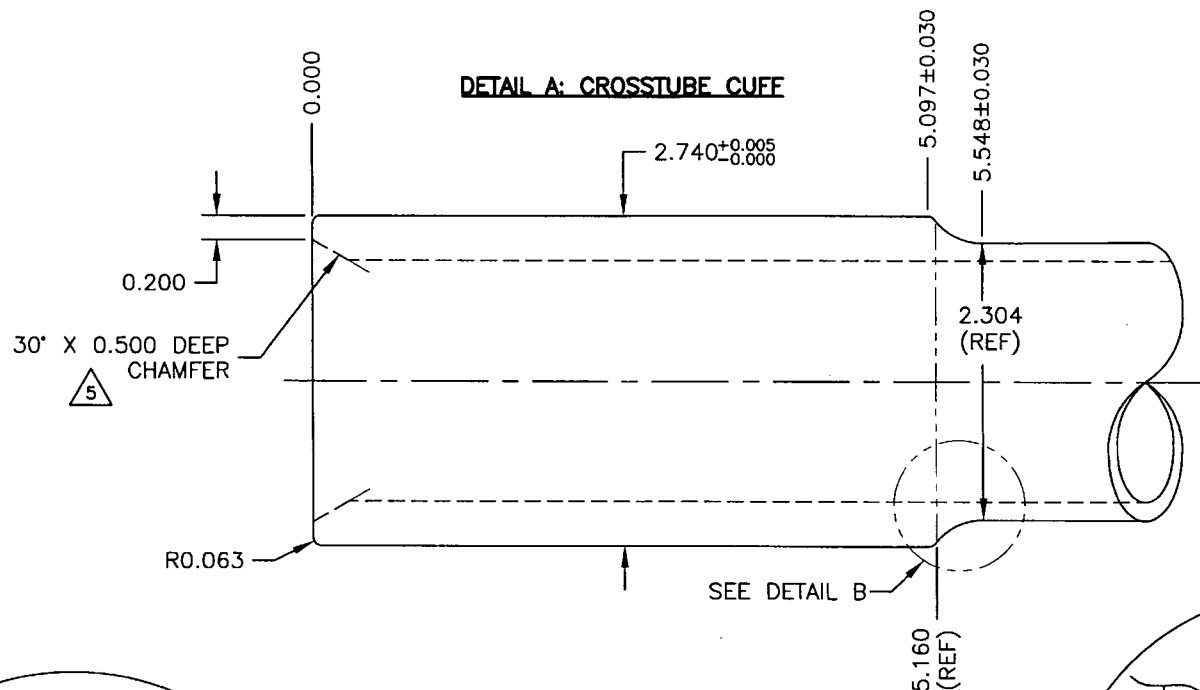

**DETAIL B: CUFF  
TRANSITION**  
SCALE 4:1

**DETAIL C:  
TAPER RUN-OFF**  
NOT TO SCALE

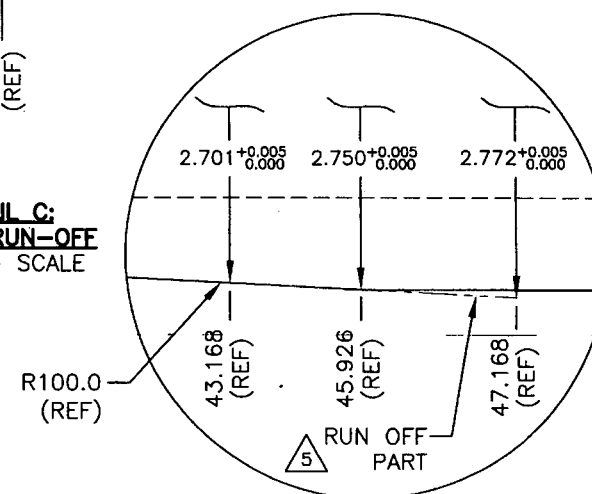

NO. 10176  
WORK ORDER  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
SHOP COPY  
RETURN TO  
ENGINEERING

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE LTD.

DESIGN PH	DRAWN BY PH	<b>DART</b>	DART AEROSPACE LTD. MARKHAM, ONTARIO, CANADA
CHECKED J	APPROVED J	DRAWING NO. D212-664-141	REV. C SHEET 3 OF 3
DATE 07.03.08	TITLE XTUBE ASS'Y (205/212/412 HI FWD)	SCALE 1:1	



# LIQUID PENETRANT TEST REPORT

P - 1386 1

CLIENT	DART AEROSPACE	DATE	JULY 11, 2008	PAGE	1	OF	1
ATTENTION	LINDA LACELLE	ACUREN JOB NO.	188 08 1386	TIME	AM <input type="checkbox"/>	PM <input type="checkbox"/>	
ADDRESS	1270 ABERDEEN ST	PO/VO No.	6753				
	HAWKESBURY, ONT.	WORK LOCATION	HAWKESBURY				
		ACCEPTANCE STD.	ASTM 1417/QSI-038	REV./DATE	2005		
PROJECT	412 HIGH AFT X TUBES, 212/205 HIGH FED X TUBES, 206L AFT X TUBE.						
ITEM(S) EXAMINED	JOB #S 39907, 40175, 40176, 40116, 40117..						

JOB DESCRIPTION	PROCEDURE NO. LT-0002	REV./DATE	TECHNIQUE NO. LT-TECH2	REV./DATE
PART NO. D412664203 /D212664101/D206667203.		MATERIAL ALODINED ALUM.		THICKNESS
SCOPE WET FLOURESCENT LIQUID PENETRANT INSPECTION CARRIED OUT ON 100% EXTERNAL SURFACE				

## TEST DETAILS

METHOD	<input checked="" type="checkbox"/> FLUORESCENT	<input type="checkbox"/> VISIBLE	<input checked="" type="checkbox"/> WATER WASH	<input type="checkbox"/> SOLVENT REMOVABLE	<input type="checkbox"/> POST EMULSIFIED
FAMILY BRAND	MAGNAFLUX		BLACK LGHT8171	<input type="checkbox"/> OUTPUT > 1000 $\mu$ W/CM <sup>2</sup>	<input type="checkbox"/> AMBIENT < 2 fc
PENETRANTZL67	MINIMUM DWELL TIME	45 MIN.	LIGHTING EQUIP.	<input type="checkbox"/> FLASHLIGHT	<input type="checkbox"/> TROUBLELIGHT
PENETRANT REMOVER H2O	MINIMUM DRY TIME	>10 MIN.	OTHER	CAL JUNE 16 08	
DEVELOPER SKDS2	MINIMUM DWELL TIME	10 MIN.	LIGHT METER S/N	CAL DUE DATE	
DEVELOPER TYPE	<input checked="" type="checkbox"/> NON AQUEOUS	<input type="checkbox"/> AQUEOUS	<input type="checkbox"/> DRY		

## TEST SURFACE

SURFACE CONDITION	<input type="checkbox"/> AS GROUND	<input type="checkbox"/> AS WELDED	<input type="checkbox"/> MACHINED	<input type="checkbox"/> SHOT BLASTED	<input checked="" type="checkbox"/> CLEAN BARE METAL
SURFACE TEMPERATURE	<input type="checkbox"/> < - 4°C/ 20°F	<input type="checkbox"/> - 4°C/ 20°F TO 10°C/50°F	<input type="checkbox"/> 10°C/50°F TO 52°C/125°F	<input type="checkbox"/> > 52°C/125°F	

## RESULTS- (☐ METRIC ☒ IMPERIAL)

FLUORESCENT LIQUID PENETRANT INSPECTION  
CARRIED OUT ON 100% EXTERNAL  
SURFACE ON:

412 HIGH AFT X TUBE JOB#s 39907.

212/205 HIGH FED X TUBES JOB#s 40175, 40176.

206L AFT X TUBE JOB#s: 40116, 40117.

mm 08 07 14

RESULTS: NO INDICATION OF DEFECTS.  
ITEMS ACCEPTABLE TO STANDARD

**Scope of Services**  
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner operator and the owner operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

**Standard of Care**  
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

## SIGNATURES

CLIENT REPRESENTATIVE		DTR # E 19909	
TECHNICIAN (SIGNATURE):		REPORT REVIEWED BY:	
NAME (PRINT):	JASON HEWETT	NAME INITIALS	
	1 <sup>ST</sup> TECHNICIAN	2 <sup>ND</sup> TECHNICIAN	
CGSB LEVEL	2	CGSB LEVEL	SNT LEVEL
CGSB REG. No	6156	CGSB REG. No	

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY